

# Service Bulletin

---

## Subject:

Installation of revised shoulder harness restraint.

## Applicability:

GA200 all serial numbers  
GA200C aircraft prior to Serial No. 200C-0145.

## Background:

Although the static strength of the existing installation meets all relevant design and certification requirements, improved capability will be achieved from the new installation.

## Compliance:

Installation of the revised shoulder harness restraints must be completed within 100 hours time in service from the receipt of this Service Bulletin.

## Weight and Balance:

Negligible change.

## Parts:


The following parts are supplied with Service Bulletin.

Part	Description	Qty
GA200-251011-9	Cable Assembly	2
GA200-251001-51	Bush	2
AN4-7	Bolt	4
AN970-4	Penny Washer	4
AN960-416	Washer	4
MS21042-4	Nut	4

## Incorporation Instructions:

1. Remove existing 1/8" retaining cable from each shoulder harness to aircraft attachment. For aircraft that incorporate a cable that has been swaged integrally with the upper harness yoke it will be necessary to cut the old cable free, ensuring that the harness yoke is not damaged.

2. Install new 5/32" retaining cable P/N GA200-251011-9 using attaching parts as shown in Figure 1 below.

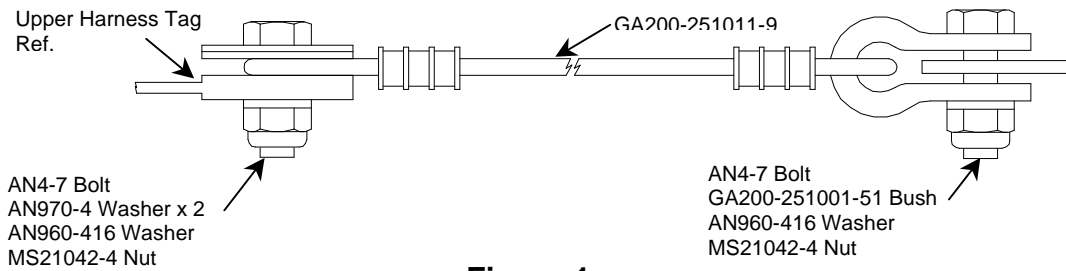

**Figure 1**

## Approval:

This Service Bulletin has been approved pursuant to Regulation 35 of the CAR 1988